

OFFICE OF THE MARION COUNTY SURVEYOR  
SECTION RECORD CORNER

SECTION 10 TOWNSHIP 16 RANGE 3

DATE: 5-30-03

PARTY CHIEF: Wilcoxon

CREW: Harrison

TYPE OF MARKER: Survey marker nail over

METHOD OF ESTABLISHMENT: RR spike 3" dn


County: 6-8-02

IN. S.P.C. E ZONE NAD '83

NAME: 16031001

N: 511409.5684(m)

E: 54557.3462(m)

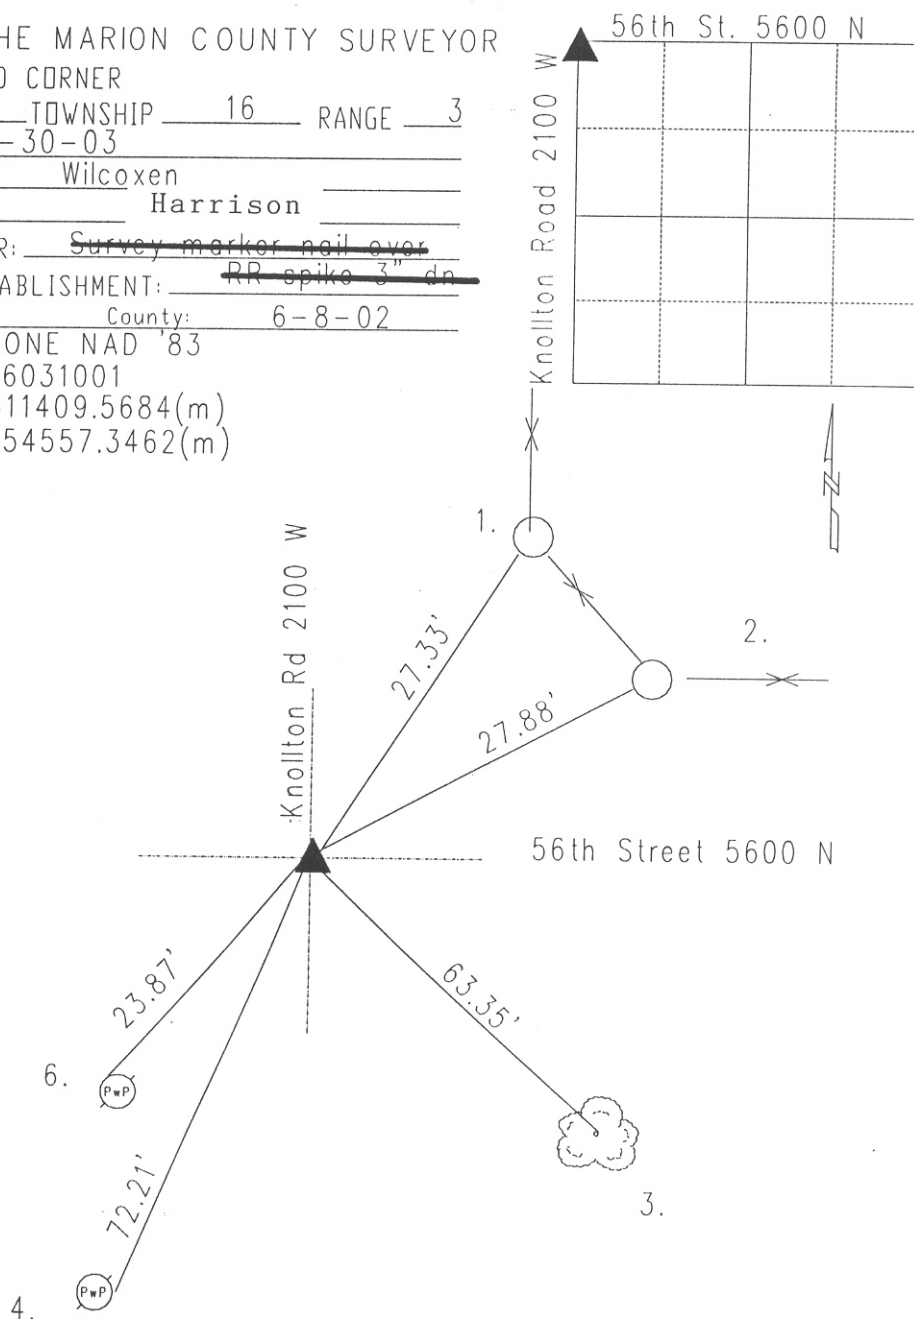

16031001

REF.	DISTANCE	DESCRIPTION
1.	27.33'	Face of steel corner fence post
2.	27.88'	Face of steel corner fence post
3.	63.35'	Bolt spike E 24" elm 6" up
4.	72.21'	PK nail E PwP#68-331 -B 12" up
5.	23.87'	Cut 'x' in bolt NW PwP#69-331-B 36" up

Corner originally set as a post in 1820 by Wm. B. Laughlin with the following witnesses: 3" hickory bearing south 47 degrees, thence east 7 links; and a 36" beech bearing north 25 degrees, thence west 28 links. (M.C. Atlas p.7) A survey by Wm. P. Smith on April 7, 1869 indicates a stone with the following witness: 18" walnut bearing north 3.25 degrees, thence west 52 links. (Washington Legal Book p.52) Corner referenced by Monroe on 3/26/51 and called a spike. Corner referenced by Miller on 11/17/75 and called a road nail in washer. Corner referenced by Wilcoxon on 2/27/87 and called a R.R. spike. Corner referenced by Kiste on 10/16/97 and called a R.R. spike. Corner referenced by Wilcoxon on 6/8/02 and called a survey marker nail. Corner excavated by Kiste on 5/20/03 and a survey marker nail was found 2" down. A R.R. spike was found 5" down. A half-inch iron pipe was found inside a 1.5" lead pipe 17" down. A #205 cast iron Harrison monument was set in position as the corner.